

Single Survey

Survey report on:

Property Address	24 Finbraken Drive Gourrock PA19 1BF
Customer	Mr A Kayes & Mrs M Kayes
Date of Inspection	13/02/2025
Prepared by	Andrew G Scrimgeour Harvey Donaldson & Gibson Chartered Surveyors



HARVEY
DONALDSON
& GIBSON
CHARTERED SURVEYORS

Parent to HomeReportScotland.scot

TERMS AND CONDITIONS

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who will have sufficient current local knowledge of the particular market to competently survey, value and report upon Residential Property. ¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by checking the adjacent box.

Harvey Donaldson & Gibson is part of the Connells Group. In Scotland, the Connells Group also own Slater Hogg & Howison, Countrywide North and Allen & Harris. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected. A full list of the Connells group brands is available on <https://www.connellsgroup.co.uk/our-group/our-brands/>. Harvey Donaldson & Gibson is regulated by RICS for the provision of surveying services. This means we agree to uphold the RICS Rules of Conduct for Firms and all their applicable mandatory professional practice requirements of RICS, which can be found at www.rics.org. As an RICS regulated firm we have committed to cooperating with RICS in ensuring compliance with its standards. The firm's nominated RICS Responsible Principal is Rebecca Freeman FRICS, contact 01332 813096.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same

transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential Surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

¹Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

²Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subjects comprise an extended two storey detached house.
Accommodation	Ground Floor: Entrance vestibule, hallway, living room, dining kitchen with large open plan living room, utility room, side entrance, toilet compartment and integral double garage. First Floor: Landing, master bedroom with en-suite shower room, second bedroom with en-suite shower room, three further bedrooms and family bathroom.
Gross internal floor area (sqm)	198 m2 approximately, excluding the integral double garage.
Neighbourhood and location	The property is situated in a residential area developed with properties of a similar age and style within the town of Gourrock. Local amenities are available within a reasonable distance.
Age	22 years approx.
Weather	It was dry at the time of the inspection.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. The chimney stack is of rendered masonry construction with lead flashings.

Roofing including roof space	<p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The main roof structure is pitched, timber supported and covered with concrete tiles incorporating lead lined valley gutters.</p> <p>There are two accesses to the roof spaces. These areas are insulated at ceiling joist level and partly floored.</p> <p>The rear projection has a shallow pitched roof covered with a modern single ply rubber membrane.</p>
Rainwater fittings	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>The rainwater fittings are plastic components.</p>
Main walls	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The main walls are of traditional cavity brick/block construction, finished externally with render and mock stone blockwork. Cavity wall insulation has been installed.</p> <p>The extended portion of the property above the garage is of steel frame construction with timber framed infill finished externally with render.</p> <p>The rear extension is of steel framed construction with timber frame infill, finished externally with timber claddings.</p>

<p>Windows, external doors and joinery</p>	<p>Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open.</p> <p>It should be appreciated that double glazed sealed units do have a limited life expectancy, and defective seals can lead to condensation between the panes, necessitating in the replacement of the unit. This can sometimes only be obvious during adverse weather conditions.</p> <p>The windows are mostly UPVC framed double glazed units of varying age. The windows and doors to the rear extension are aluminium framed double glazed units. The front door is a composite style unit with timber finish. The soffit and fascia boards are UPVC.</p>
<p>External decorations</p>	<p>Self coloured joinery</p>
<p>Conservatories / porches</p>	<p>None</p>
<p>Communal areas</p>	<p>None</p>
<p>Garages and permanent outbuildings</p>	<p>Visually inspected.</p> <p>There is an integral double garage with electric door.</p>
<p>Outside areas and boundaries</p>	<p>Visually inspected.</p> <p>There are garden grounds to the front and rear elevations. There is a mono-blocked driveway. The rear garden has been landscaped in the recent past and incorporates a garden room, which adjoins the rear extension. There is also another covered area, which incorporates an external sauna.</p> <p>Boundaries are formed by timber fences and hedges.</p>
<p>Ceilings</p>	<p>Visually Inspected from floor level.</p> <p>Ceilings throughout the property are of plasterboard materials.</p>

Internal walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>Internal partitions are of stud design, plasterboard lined on both faces.</p>
Floors including sub floors	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>The property has fully fitted floor coverings throughout which restricted the scope of our inspection.</p> <p>The floors are of suspended timber construction. All floors were covered with fixed coverings.</p> <p>No sub-floor inspection has been undertaken. No access was located.</p>
Internal joinery and kitchen fittings	<p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>The internal doors are timber and glazed timber units. The skirtings and door surrounds are moulded. The staircase is timber. The kitchen and utility room are fitted with a range of contemporary wall and base units.</p>

<p>Chimney breasts and fireplaces</p>	<p>Visually inspected.</p> <p>No testing of the flues or fittings was carried out.</p> <p>The chimney breast is plasterboard lined. There is a log burner within the living room.</p> <p>There is a dual fuel stove within the rear extension.</p> <p>The internal condition and serviceability of any flue cannot be determined from a visual inspection. Old unlined flues will inevitably deteriorate with age as the acidic products of combustion erode the bricks and mortar joints. As a result they may not be completely smoke and fire tight. For this reason they should be cleaned and smoke tested before use.</p>
<p>Internal decorations</p>	<p>Visually inspected.</p> <p>The ceilings and walls are painted and papered. The internal joinery is painted.</p>
<p>Cellars</p>	<p>None</p>
<p>Electricity</p>	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>A mains supply is connected. The meter and consumer unit are located within the understair cupboard.</p> <p>There is an electric vehicle charging point.</p>
<p>Gas</p>	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>A mains supply of gas is connected. The meter is located in an external meter box which is located to the left hand side of the property.</p>

Water, plumbing and bathroom fittings	<p>Visual inspection of the accessible pipework, water tank or cylinders (if applicable) and fittings without removing any insulation.</p> <p>The pipes are of copper and plastic materials.</p> <p>The sanitary fittings are mostly modern replacement units. One of the shower rooms has the original fittings.</p>
Heating and hot water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Central heating is by way of a wall mounted gas fired system boiler located in the garage. This supplies a system of hot water radiators. Hot water is by way of the heating system and an insulated hot water cylinder located within a cupboard off one of the rear bedrooms.</p>
Drainage	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Mains drainage is understood to be connected.</p>
Fire, smoke and burglar alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>The property has smoke detection devices installed.</p> <p>Scottish government regulations came into effect on 1st February 2022 which requires each property to have linked smoke and heat detectors and if gas/carbon burning appliances are present then a carbon monoxide alarm fitted. Purchasers should satisfy themselves with regards to compliance.</p> <p>The subjects have a security system installed.</p>

Any additional limits to inspection

The property was inspected within the limits imposed by occupation which included, throughout, closely nailed and fixed fitted carpeting, floor coverings, stored items and furnishings etc. The owner's personal belongings were not removed from cupboards.

It will be appreciated that parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

This report does not constitute a full and detailed description of the property and a structural investigation was not carried out. No inspection was undertaken of woodwork or other parts of the structure which are covered, unexposed or otherwise inaccessible and as a result no guarantee can be given that such parts of the structure are free from rot, beetle or other defects.

No removal of internal linings has been carried out in order to ascertain the condition of hidden parts and no warranty can be given regarding the areas not specifically referred to in this report.


The external building fabric has been inspected from ground level only from the subjects grounds and where possible from adjoining public property. Exposure work has not been carried out.

It was dry on the date of inspection. Leakage and water penetration may only be visible to building components such as roof spaces, rainwater goods, around chimney breasts, window openings, etc. These are sometimes only visible during or immediately after, adverse weather conditions.

Similarly, sometimes defects in rainwater goods are only apparent during, or after heavy rainfall.

The report does not include an asbestos inspection. However, asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported and you have concerns you should engage a qualified asbestos surveyor.

Sectional Diagram showing elements of a typical house

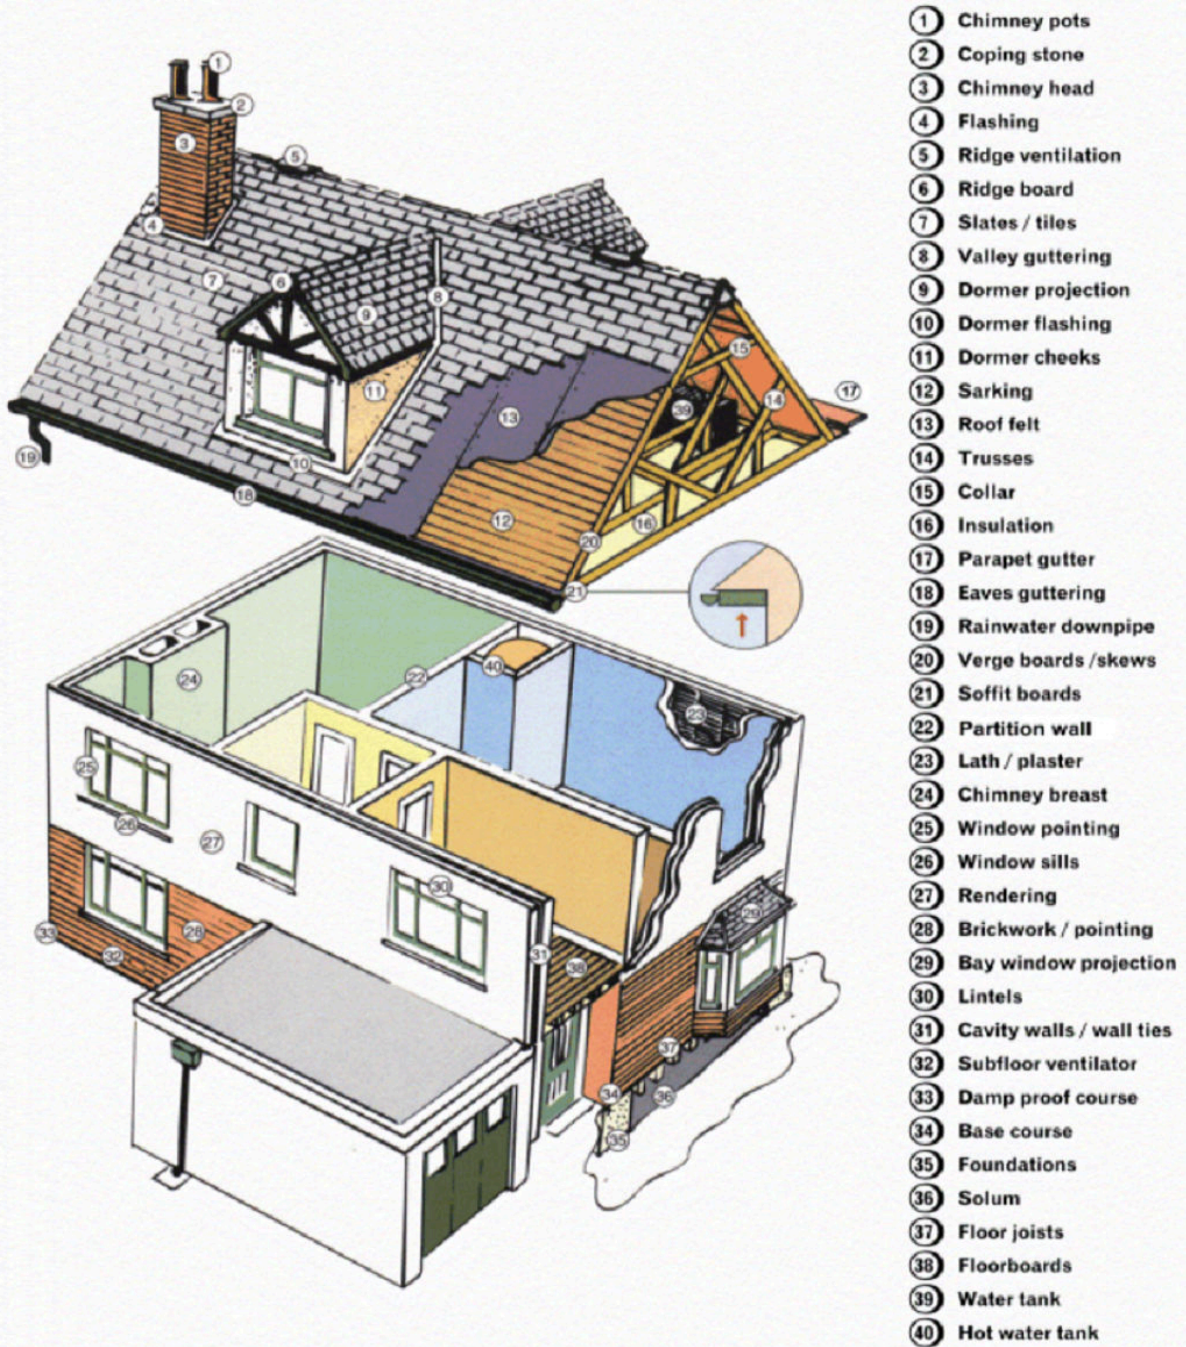

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3 3	Category 2 2	Category 1 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes	<p>No obvious significant structural movement noted, on the basis of a single inspection.</p> <p>All buildings move daily and seasonally as a result of external factors such as gravity, temperature, moisture content and vibrations. Consequently most buildings will have minor non structural cracks related to these factors. Minor cracks can be filled during normal redecoration but often recur seasonally due to normal movement in a building. Non structural cracks of this nature will not be recorded or reported.</p>

Dampness, rot and infestation	
Repair category:	1
Notes	Damp penetration was noted within the roof space at the chimney head - this was noted to be dry.

Chimney stacks	
Repair category:	2
Notes	<p>Cracking to chimney head rendering was noted, and the need for cutting back to the bare masonry and recoating should not be discounted. There is evidence of damp ingress within the roof space around the chimney head - this area was dry when tested. This is likely to be a progressive defect if left unattended.</p> <p>It should be noted that unused chimney heads are a common source of water ingress with the resultant risk of deterioration to the brickwork and surrounding timbers within the roof void.</p>

Roofing including roof space	
Repair category:	1
Notes	<p>ROOF COVERING:</p> <p>No obvious significant defects were noted to the roof structures or coverings, within the limitations of the inspection. Ridge pointing is starting to deteriorate.</p> <p>FLAT ROOFS:</p> <p>No obvious significant defects were noted to the flat roof covering. It should be fully appreciated that a flat roof, even when new does have a limited life and always requires regular and careful ongoing maintenance to ensure it remains in a wind and watertight condition.</p> <p>ROOF VOID:</p> <p>Active damp penetration was noted at various locations throughout the roof space, and it should be fully appreciated that timbers in contact with dampness are prone to decay. Please see our previous comments under Dampness, Rot and Infestation.</p>

Rainwater fittings	
Repair category:	1
Notes	<p>No significant disrepair was noted to the rainwater goods.</p> <p>Allowing leaves, moss, and other debris to accumulate and create blockages is one of the most frequent causes of gutter-related dampness problems. The weight of the accumulated material can cause gutters to leak at joints or even to collapse completely. However, all of this may be prevented by cleaning gutters frequently, preferably twice a year.</p>

Main walls	
Repair category:	1
Notes	No obvious significant defects were noted to the accessible wall surfaces. Render around where the extension meets the original part of the house to the left hand gable needs minor attention.

Windows, external doors and joinery	
Repair category:	1
Notes	No obvious significant defects were noted to the windows, doors or external joinery allowing for age and wear.

External decorations	
Repair category:	
Notes	Not applicable

Conservatories / porches	
Repair category:	
Notes	Not applicable

Communal areas	
Repair category:	
Notes	Not applicable

Garages and permanent outbuildings	
Repair category:	1
Notes	No obvious significant defects noted to the garage.

Outside areas and boundaries	
Repair category:	1
Notes	No reportable defects were noted to outside areas and boundaries. Timber to the external parts of the garden room are weathered. This is of basic construction.

Ceilings	
Repair category:	1
Notes	No obvious significant defects were noted to the ceiling surfaces.

Internal walls	
Repair category:	1
Notes	No obvious significant defects were noted to the internal walls.

Floors including sub floors	
Repair category:	1
Notes	No obvious significant defects were noted to flooring.

Internal joinery and kitchen fittings	
Repair category:	1
Notes	No obvious significant defects were noted to internal joinery or kitchen fittings.

Chimney breast and fire places	
Repair category:	1
Notes	<p>No obvious significant defects were noted to the chimney breast or fireplace.</p> <p>It is assumed that the burners have been installed in accordance with the appropriate regulations. Appliances such as this should be serviced on at least an annual basis. If there are no signs of recent servicing, then this should be commissioned prior to use.</p>

Internal decorations	
Repair category:	1
Notes	<p>No obvious significant defects were noted to the internal decoration. Minor attention required where fixtures have been removed.</p>

Cellars	
Repair category:	
Notes	Not applicable

Electricity	
Repair category:	1
Notes	<p>No obvious significant defects were noted, however, only the most recently constructed or re-wired properties have installations which fully comply with current regulations. It is good practice to have electrical systems fully tested upon a change in ownership, where upgrading may be identified by the contractor.</p>

Gas	
Repair category:	1
Notes	<p>No obvious significant defects noted to the gas installation.</p> <p>All gas appliances should be tested and thereafter maintained by a Gas Safe registered contractor on an annual basis. This should be regarded as a routine maintenance and safety check.</p>

Water, plumbing and bathroom fittings	
Repair category:	1
Notes	<p>No obvious significant defects were noted to the accessible plumbing fixings or sanitary fittings.</p> <p>The mastic seal to the base of the older shower shows signs of wear. Any leakage around defective seals will put concealed areas at risk of defects.</p>
Heating and hot water	
Repair category:	1
Notes	<p>The system was not running at the time of inspection but appeared serviceable.</p> <p>It is recommended good practice that gas boilers are serviced on an annual basis by an appropriately qualified person. The boiler's service history should be checked by referring to the service records. If there is no record of a recent service, the boiler should be checked by an appropriately qualified person.</p>
Drainage	
Repair category:	1
Notes	<p>No obvious significant defects were noted to the drainage system, within the limitations of the inspection.</p>

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1	Category 3 3 Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
Dampness, rot and infestation	1	
Chimney stacks	2	
Roofing including roof space	1	Category 2 2 Repairs or replacement requiring future attention, but estimates are still advised.
Rainwater fittings	1	
Main walls	1	Category 1 1 No immediate action or repair is needed.
Windows, external doors and joinery	1	
External decorations		
Conservatories / porches		
Communal areas		
Garages and permanent outbuildings	1	
Outside areas and boundaries	1	
Ceilings	1	
Internal walls	1	
Floors including sub floors	1	
Internal joinery and kitchen fittings	1	
Chimney breasts and fireplaces	1	
Internal decorations	1	
Cellars		
Electricity	1	
Gas	1	
Water, plumbing and bathroom fittings	1	
Heating and hot water	1	
Drainage	1	

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes
3. Is there a lift to the main entrance door of the property?	No
4. Are all door openings greater than 750mm?	Yes
5. Is there a toilet on the same level as the living room and kitchen?	Yes
6. Is there a toilet on the same level as a bedroom?	Yes
7. Are all rooms on the same level with no internal steps or stairs?	Yes
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer
<p>The tenure is understood to be outright ownership. The management and service charge details have not been inspected and it is assumed it does not contain onerous provisions which would adversely affect valuation.</p> <p>The property has been altered and extended. The valuation is given on the assumption that full certification in respect of the planning permissions, building warrants and completion certificates were issued for these works.</p> <p>Scottish government regulations came into effect on 1st February 2022, which requires each property to have linked smoke and heat detectors and if gas/carbon burning appliances are present then a carbon monoxide alarm fitted. Purchasers should satisfy themselves with regards to compliance.</p> <p>In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.</p>

Estimated re-instatement cost (£) for insurance purposes
<p>The estimated reinstatement cost for insurance purposes is £600,000 (Six Hundred Thousand Pounds Sterling).</p> <p>This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.</p>

Valuation (£) and market comments
<p>In its present condition the opinion of valuation for the Outright Ownership interest with vacant possession on 09/03/2024 is £500,000 (five hundred thousand pounds).</p> <p>This is a Replacement Single Survey. The original Home Report was carried out on 09/03/2024.</p>

Report author:	Andrew G Scrimgeour
Company:	Harvey Donaldson & Gibson Chartered Surveyors
Address:	Standard Buildings 94 Hope Street Glasgow G2 6PH
Electronically Signed By:	Andrew G Scrimgeour
Date of report:	13/02/2025

Mortgage Valuation Report

CASE DETAILS

Seller Name(s):	Mr A Kayes and Mrs M Kayes.		
Property Address:	24 Finbraken Drive		
Town:	Gourock	County:	
Postcode:	PA19 1BF		
Date of Inspection (dd/mm/yyyy):	13/02/2025		

PROPERTY DETAILS

Property Type:	House		
Property Style:	Detached		
Was the property built for the public sector?	No		
For Flats and Maisonettes:	Floor the Property is on:	Number of Floors in the Block:	
Number of Units in the Block:	Does the Block have a Lift?		

TENURE

Tenure:	Absolute Ownership		
If leasehold:			
Unexpired term (Years):		Ground Rent (pa):	£

ACCOMODATION

No. of Living Room(s):	2	No. of Bedroom(s):	5	No. of Kitchen(s):	1
No. of Bathroom(s):	3	No. of WC(s):	1	No. of Other room(s):	2
Description of Other room(s) :	1 utility room and 1 conservatory				
Floor Area (m ²):	266	Floor Area type:	External		

GARAGES & OUTBUILDINGS

Garages:	1 double garage.
Permanent Outbuildings:	Garden room.

CONSTRUCTION

Wall Construction:	Timber Frame		
Roof Construction:	Pitched tile		
Approximate Year of Construction:	2002	Any evidence of alterations or extensions?	Yes
Alterations / Extensions details:	The property has been altered and extended. The valuation is given on the assumption that full certification in respect of the planning permissions, building warrants and completion certificates were issued for these works.		

RISKS

Is there evidence of movement to the property?	No	If Yes, does this appear longstanding?	
Are there any other risk matters?	No		
If yes to any of the above, please provide details:			

SERVICES

Electricity:	Mains	Gas:	Mains	Water:	Mains
Central Heating:	Full	Drainage:	Mains		
Provide comments:					

LEGAL MATTERS

Are there any apparently legal issues to be verified by the conveyancer?	Yes
If yes, please provide details:	The property has been altered and extended. The valuation is given on the assumption that full certification in respect of the planning permissions, building warrants and completion certificates were issued for these works.

LOCATION

Location details:	The property is situated within a mainly residential area with an average level of local amenities.
-------------------	---

ROADS

Road description:	The road has been adopted.
-------------------	----------------------------

GENERAL REMARKS

The property has been well maintained both internally and externally.
 The tenure is understood to be outright ownership. The management and service charge details have not been inspected and it is assumed it does not contain onerous provisions which would adversely affect valuation.

The property has been altered and extended. The valuation is given on the assumption that full certification in respect of the planning permissions, building warrants and completion certificates were issued for these works.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.
 In its present condition the opinion of valuation for the Outright Ownership interest with vacant possession on 09/03/2024 is £500,000.00 (five hundred thousand pounds). This is a Replacement Single Survey. The original Home Report was carried out on 09/03/2024.

ESSENTIAL REPAIRS

None

MORTGAGEABILITY REMARKS

The property affords adequate security for loan purposes based on the valuation figure

VALUATION

Market Value in present condition:	£ 500000
Market Value after essential repairs:	£
Insurance reinstatement value:	£ 600000
Retention required?	<input type="text" value="No"/> Retention amount:
Are repairs required?	<input type="text" value="No"/> Estimated cost of repairs:
	£

DECLARATION

Surveyor's Name	<u>Andrew G Scrimgeour</u>	Surveyor's Qualifications	<u>MRICS</u>	Report Date (dd/mm/yyyy):	<u>13/02/2025</u>
Company Name	<u>Harvey Donaldson & Gibson Chartered Surveyors</u>	Address	<u>Standard Buildings 94 Hope Street Glasgow G2 6PH</u>		
Telephone Number	<u>01414321640</u>	Email Address	<u>https://homereportscotland.scot/</u>		

Surveyor's Signature